



CONNECTION DIAGRAM

DANGER: ELECTRICAL SHOCK HAZARD,
DISCONNECT POWER BEFORE SERVICING.

LADDER DIAGRAM

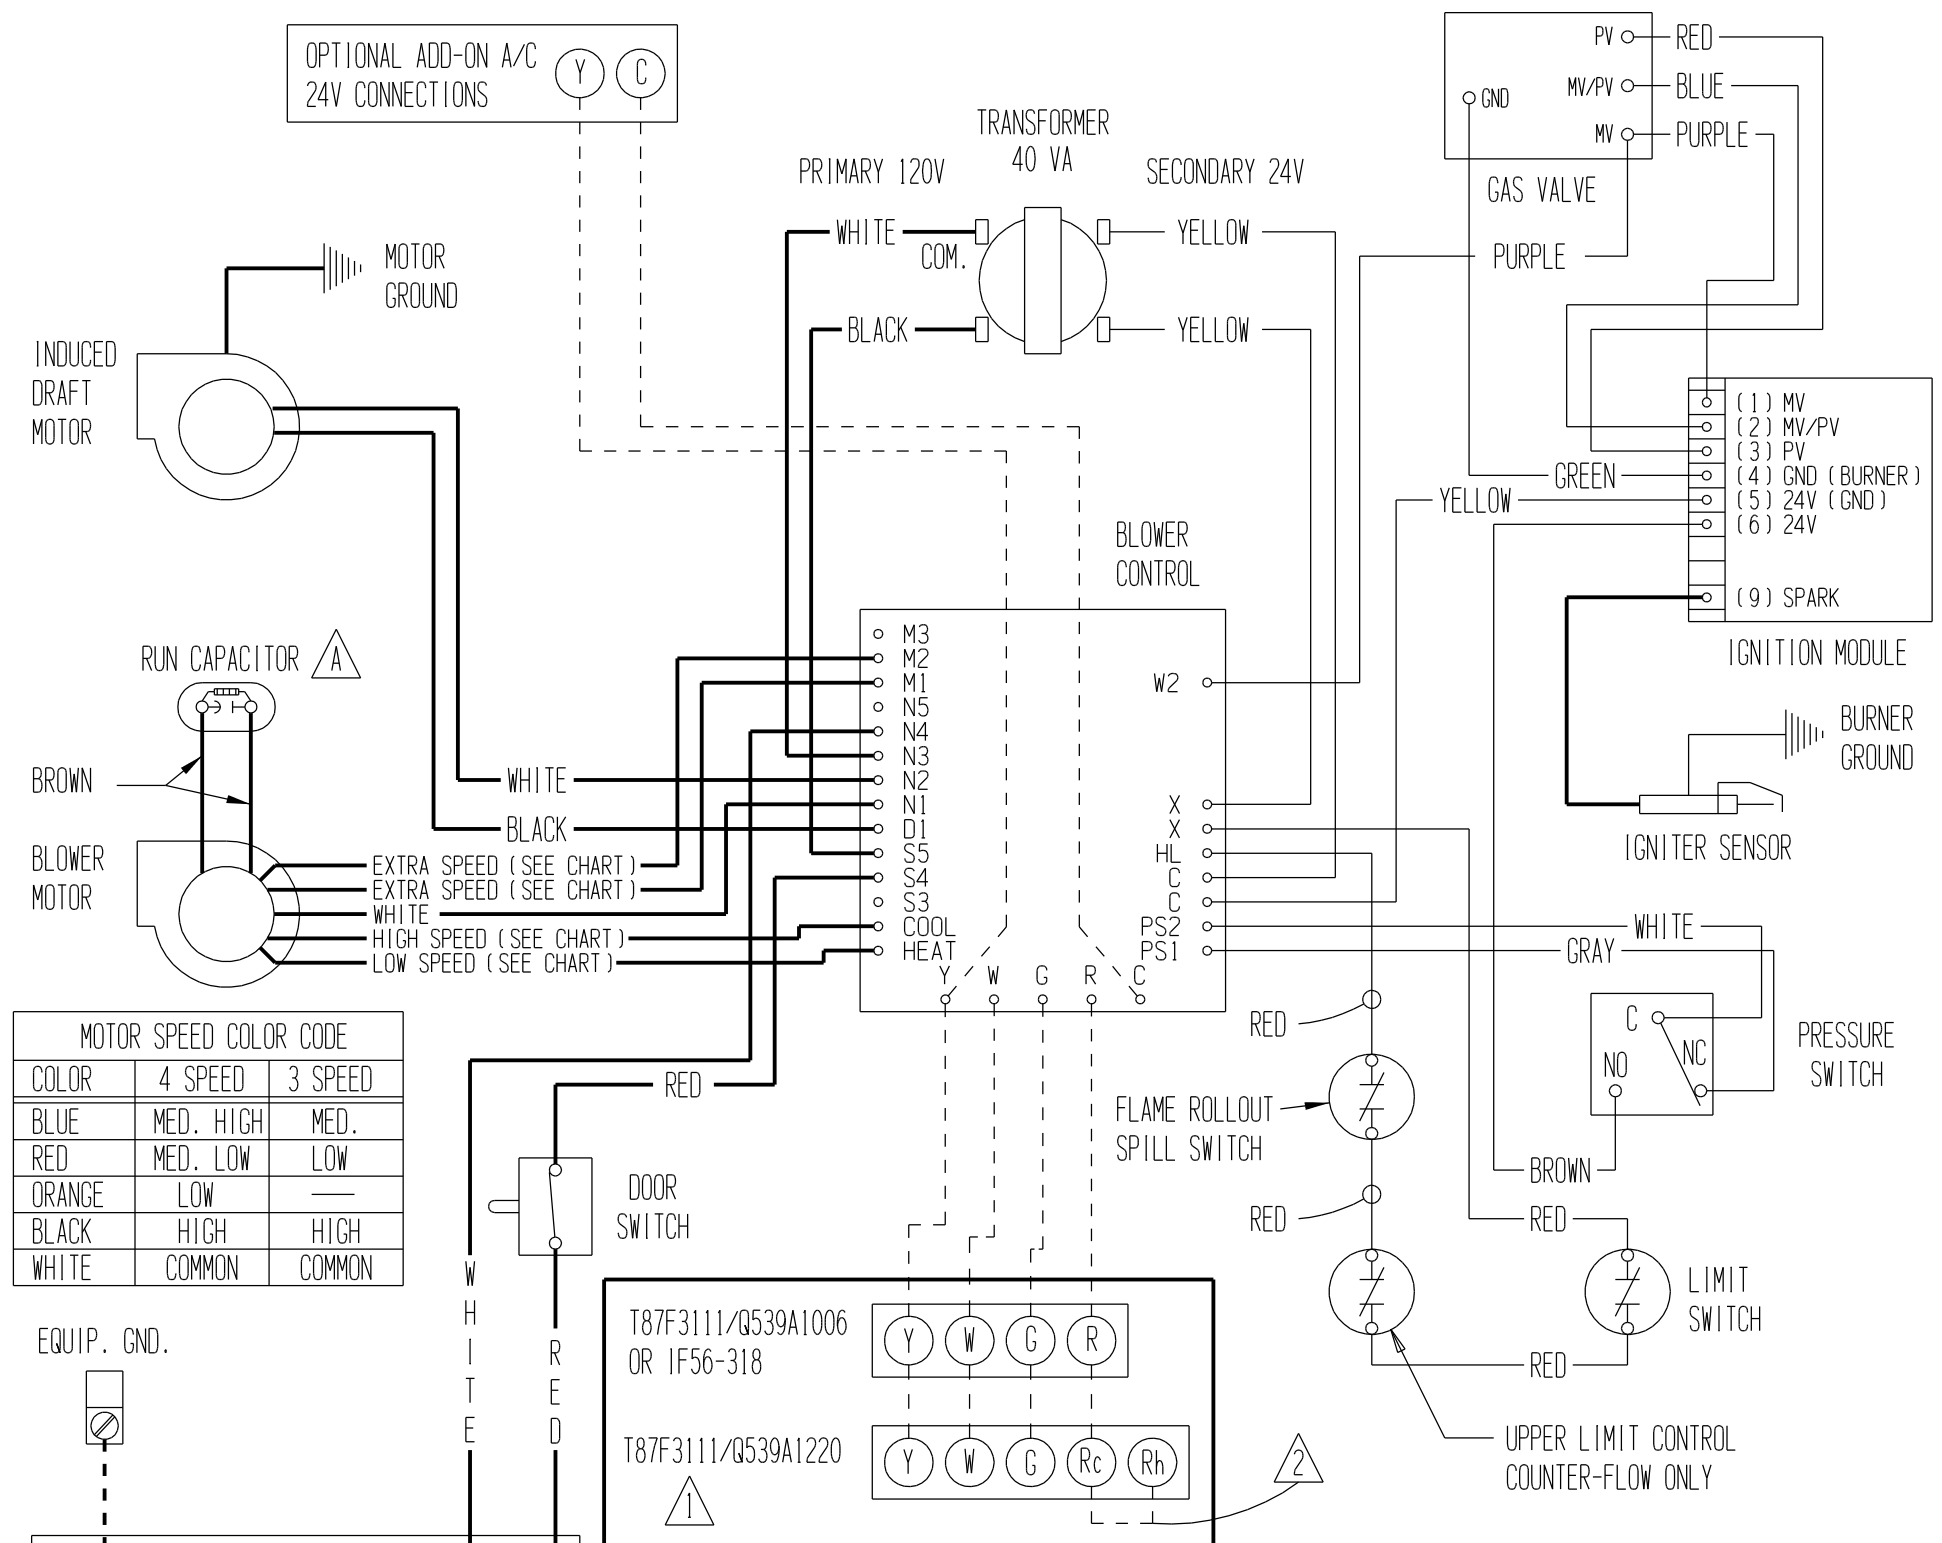

MOTOR SPEED COLOR CODE		
COLOR	4 SPEED	3 SPEED
BLUE	MED. HIGH	MED.
RED	MED. LOW	LOW
ORANGE	LOW	—
BLACK	HIGH	HIGH
WHITE	COMMON	COMMON

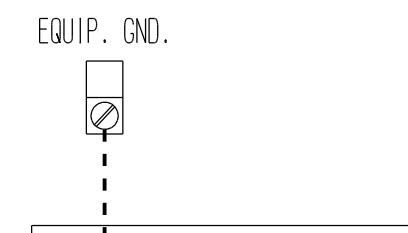


- ⚠ SET HEAT ANTICIPATOR AT .8 A FOR ALL THERMOSTATS.
- ⚠ ADDED JUMPER R_c-R_h

MODEL	RUN CAPACITOR ⚠
CC & CH060	5/370
CC & CH080	7.5/370
CC & CH100	15/370

USE COPPER CONDUCTORS ONLY

	FACTORY WIRING	FIELD WIRING
Low Voltage	—————	- - - - -
High Voltage	—————	- - - - -

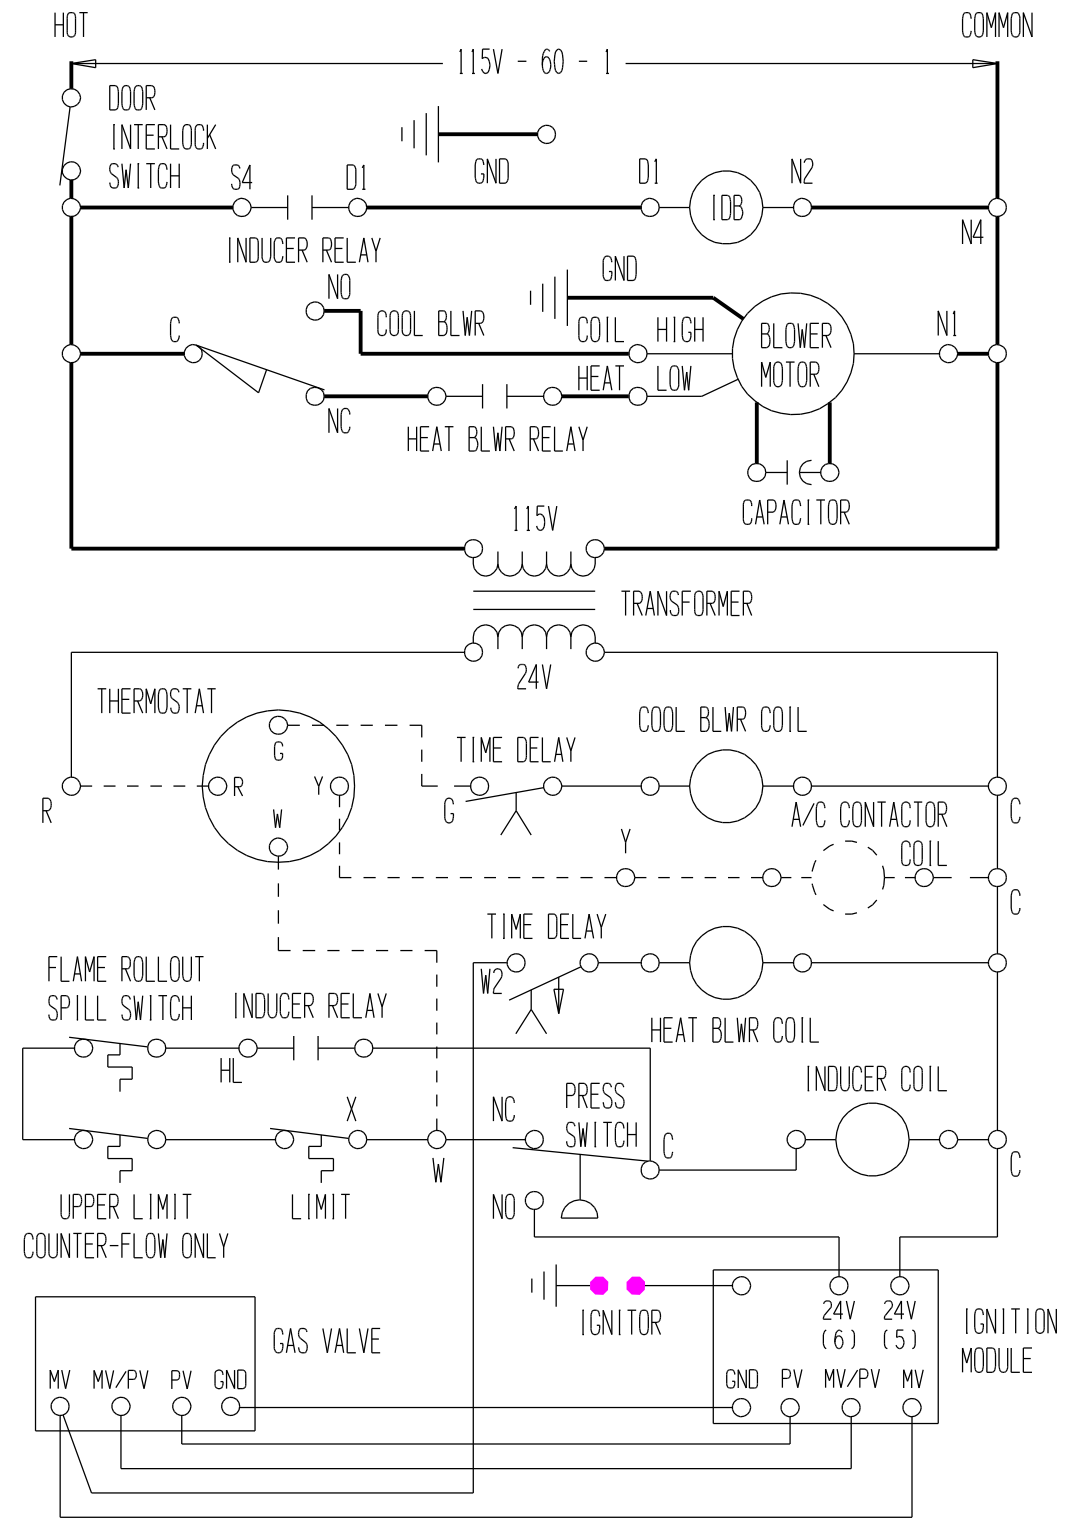

IF ANY OF THE ORIGINAL WIRE AS SUPPLIED WITH THE APPLIANCE MUST BE REPLACED, IT MUST BE REPLACED WITH WIRING MATERIAL HAVING A TEMPERATURE RATING OF AT LEAST 105° C. EXCEPT THE IGNITION CABLE WHICH IS 250° C. HIGH VOLTAGE CABLE.